


YP69P Straight male union connector.

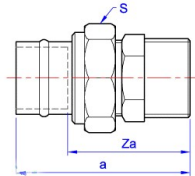

Straight male union connector. copper x BSP parallel male thread. Cone joint to BS 1010.

GENERAL INFORMATION

Size	Pattern No.	Box Qty	Code	Barcode	Price (£) ex VAT
15mm x 1/2"	YP69P	5	08840	5022050088406	£20.87
22mm x 3/4"	YP69P	5	08841	5022050088413	£27.08
28mm x 1"	YP69P	1	08842	5022050088420	£40.36
67mm x 2 1/2"	YP69P	1	08850	5022050088505	£230.25

DIMENSIONS (mm)

Code	Description	a	Za	S
08840	15mm x 1/2" YP69P	56	33	30
08841	22mm x 3/4" YP69P	66	45	37
08842	28mm x 1" YP69P	72	36	46
08850	67mm x 2 1/2" YP69P	96	48	96

PRESSURE & TEMPERATURE

YORKSHIRE POTABLE PERFORMANCE WHEN CORRECTLY ASSEMBLED WITH COPPER TUBE TO BS EN 1057

Service temperature

Size	-40° C (Min)	30° C	65° C	110° C (Max)
6mm to 54mm	16 bar	16 bar	10 bar	6 bar
67mm	10 bar	10 bar	6 bar	4 bar

GUARANTEE

Pegler Yorkshire 25 Year Guarantee - Terms and Conditions

Products are subject to a 25 year guarantee that is between Pegler Yorkshire and the final purchaser of the product.

The guarantee is subject to proof of purchase being supplied.

This guarantee does not affect any statutory rights the consumer may have in law.

The guarantee covers manufacturing or material defects when installed in accordance with our instructions on specified tube materials and applications, and does not cover parts subject to normal wear and tear.

This product range has been designed for the use of homeowners, domestic and commercial applications and therefore the Guarantee is subject to the product being properly selected for their intended service conditions.

The guarantee is not applicable where the product is fitted contrary to the conditions in the fitting instructions.

This is reinforced where valves are covered by the European Pressure Equipment Directive (PED97/23/EC) where Installation, Operating and Maintenance Instructions are supplied with each product and/or carton.

Provided it is installed correctly and receives adequate preventative maintenance it should give years of trouble-free service.

Abusive behaviour and accidental damage to the product are not covered by this guarantee.

The extent of this liability is limited to the cost of the replacement of the defective item and not to installation or consequential damages.

APPROVALS



[BSI](http://www.bsi.com)



[WRAS](http://www.wras.co.uk)